PUBLIC WORKS

2023 PAVEMENT CONDITION REPORT & THREE-YEAR PLAN



SHANE KINSEY - DIRECTOR OF PUBLIC WORKS NATHAN HUGHES - PUBLIC WORKS FOREMAN

PUBLIC WORKS 2023 PAVEMENT CONDITION REPORT & 3 YEAR PLAN

INTRODUCTION

London Grove Township Public Works recognized the need to implement means and methods to evaluate the current road conditions, in order to make informed decisions on the maintenance, repair and replacement of the existing road network. Research was conducted to find a system which would provide the needed information in a fiscally responsible manner.

It was decided to utilize a system known as "Pavement Surface Evaluation and Rating" (PASER), which was produced by the University of Wisconsin-Madison, Transportation Information Center, in conjunction with the Federal Highway Administration and the National Local Technical Assistance Program (LTAP). The PASER system is based off of ASTM D6433 "Standard Practice for Roads and Parking Lots Pavement Condition Index Survey". The PASER system does not provide specific quantitative values for inspection, so it was decided to use the "Pavement Condition Rating System" (PCR) methodology, as published by the Ohio Department of Transportation (ODOT).

It should be noted that this report is not intended to be a project-specific design tool. Its intent is to help identify the location and extent of pavement problems and to plan overall solution strategies.

METHODOLOGY


The roads were evaluated for the presence of multiple distresses, including reveling, bleeding, patching, potholes/debonding, crack sealing deficiency, rutting, settlements, corrugations, wheel track cracking, block and transverse cracking, longitudinal joint cracking, edge cracking, and random cracking. Based on this evaluation a "Pavement Condition Rating" (PCR) was assigned.


The Pavement Condition Rating indicates the overall condition of the segment. The higher the number, the better the condition. The PCR number generally indicates the condition as follows;

9-10	Very Good Condition	Little or no maintenance required
7-8	Good Condition	Routine maintenance, crack sealing and
		Minor patching recommended.
5-6	Fair Condition	Crack sealing, major patching, and
		Preventative treatments recommended.
3-4	Poor Condition	Structural improvements, leveling and
		Overlay, or recycling recommended.
1-2	Failed Roadway	Reconstruction recommended.

EVALUATION

The township's 62.94 miles of road were evaluated in January and February of 2023, using a combination of "windshield evaluation" and surface investigation. A total of 184 segments were evaluated, with no new segments being added for this evaluation. Each segment may be a whole road, or a section of a road separated due to length or significant differences in road condition.

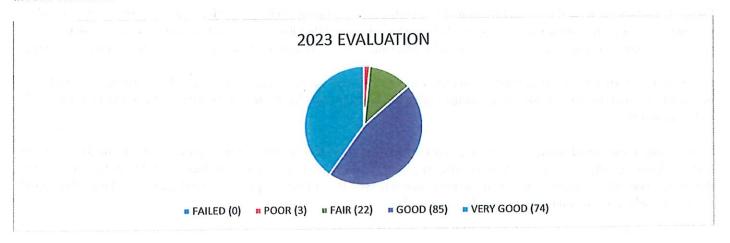

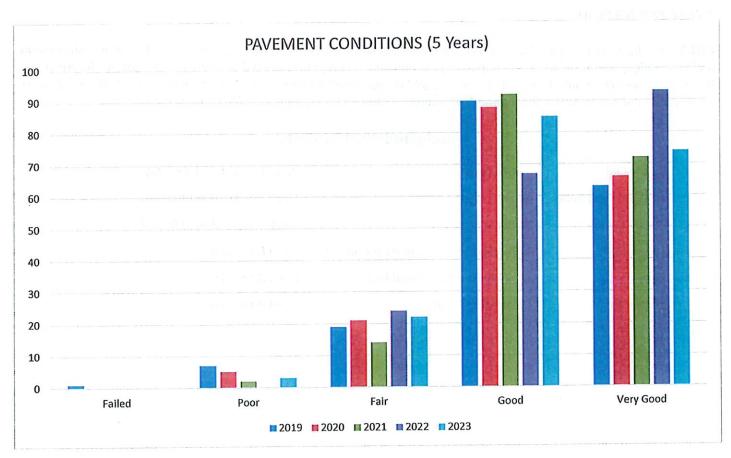

EVALUATION OUTCOME

The 2023 evaluation shows that ongoing maintenance efforts and near adequate budgeting continue to provide an overall acceptable Pavement Condition Rating and for the townships road network, resulting in good road surfaces for motorists.

You will however notice a downward trend in the overall condition ratings, this is a result of the aging of the large number of development roads constructed during the building boom of the late nineties and early two thousands. Consideration should be given in future budgets to increase the paving and surface treatment figures to address these aging roadways.

It is imperative that maintenance programs such as yearly crack sealing and selective patching continue in order to maintain the road surfaces. Additionally, budgeting to allow for resurfacing of the road network in a timely manner needs to be continued.

Considering a surface lifespan of 20 years, and 62.94 miles of roadway, we recommend a minimum of \$700,000 be budgeted, on a yearly basis, for contract resurfacing and reconstruction. This figure has increased due to increased costs due to the current economic situation in addition to decreased pavement lifespans due to the increased use of recycled materials and poorer oil quality in available asphalt mixes.

3 YEAR PAVING PLAN

Utilizing the information gained from this report, Average Daily Traffic (ADT) for segments, as well as other information and knowledge, we formulate a 3-year paving plan annually. This plan is utilized to allow preparation for future years. However, it should be noted that this planning could change due to a variety of variables, which can significantly affect the condition of a road over a short period. Planning is based on an expenditure of \$700,000.00 per year.

Budgeted 2023 Projects

0	Rosehill Rd	Entire Length	Base Repair, Level, Overlay
•	Lamborntown Road	Entire Length	Single Application Chip Seal
•	Howell Moore Rd	Entire Length	Single Application Chip Seal
•	Hipkins Rd ¹	W. Avondale Rd to New London Twp.	Level & Overlay
9	Tice Rd ¹	N. Guernsey Rd to Dead End	Level & Overlay
9	Dingee Rd ¹	State Rd to Dead End	Level & Overlay

1 - In house project.

Perspective 2024 Projects

• Wickerton Entire Subdivision Selective Base Repair, Level, Overlay

o Stratford Drive, Nottingham Drive, Sheffield Drive, and Worthington Drive.

Heather Grove Entire Subdivision Selective Base Repair, Level, Overlay

o Welcome Ave, Chartwell Rd, Arber Ct, Deer Path Ct, Heather Grove Ln, Newfield Ct, Blossom Ct, and

Sunrise Ct.

Penwyck
 Entire Road
 Selective Base Repair, Level, Overlay

Perspective 2025 Projects

Clay Creek Rd
 Entire Length
 Mill, level, overlay

Walter Rd Entire Length Double App Chip Seal

Hilton Rd
 Entire Length
 Double App Chip Seal

Perspective 2026 Projects

• E. Avondale Rd Schoolhouse to Wickerton Base Repair, level, overlay

• Kent Farm Entire Subdivision Mill, Level, Overlay

o Kent Farm Lane, Eaton Way, Flintlock Circle, Marcus Way, Bandon Circle, and Airdale Circle

• Garden Station Rd Roosevelt to Ellicott Selective Base repair, Level & Overlay

Special Consideration Roads

Hepburn Rd County Bridge to LG Village To be reconstructed under developer agreement for

London Grove West project, timing unknown.

• Baker Station Rd Hepburn to dead end To be reconstructed under developer agreement for

London Grove West project, timing unknown.

Village of Chatham Church Alley, Pennock Lane PennDOT SR41 & SR841 project will effect roadways

Strode Rd the full extent of such is unknown.

Misty Hollow DR
 SR841 to dead end
 PennDOT SR1 & SR841 interchange project will effect

Roadway, full extent is unknown

DEPARTMENT OF PUBLIC WORKS

Abby Rd		Date:	1/24/2023
From: State Rd	To: Kodi Cir	cle	
Segment Length:	1848' Average Segment Width: 20'	Dbl Yellow Ctr	\square Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maintenance red	quired	
Notes:			
		Data	1/24/2022
Abby Road	To Chala	Date:	1/24/2023
From: Kodi Circl		_	
Segment Length:	2152' Average Segment Width: 20'	□ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealin	g and Minor Patching Nee	ded
Notes:			
Airdale Circle		Date:	1/24/2023
From: Kent Farn	n Lane To: Cul-de-	sac	
Segment Length:	286' Average Segment Width: 15'	\square Dbl Yellow Ctr	\square Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealin	g and Minor Patching Nee	ded
Notes:			
A 1' D		Date:	1/24/2023
Angelica Dr	T 011		1/24/2023
From: Clay Cree		_	
Segment Length:	4358' Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maintenance rec	quired	
Notes:			
Arbor Court		Date:	1/24/2023
From: Welcome	Ave To: Cul-de-	sac	
Segment Length:	153' Average Segment Width: 23'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealir	ng and Minor Patching Nee	ded
Notes:			

DEPARTMENT OF PUBLIC WORKS

Aringa Way				Date:	1/24/2023
From: Easkey La	ane To: Cul-de-sac				
Segment Length:	2111'	Average Segment Width: 19'		\square Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	Overall condition: 7-8 Good Condition - Routine maintenance, crack Sealing a		k Sealing and	Minor Patching Nee	ded
Notes:					
			1 7 80	Doto	1/24/2023
Atherlone Way				Date:	1/24/2023
From: Tulsk Rd		То:	East Avondale		
Segment Length:	265'	Average Segment Width: 20'		☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good C	ondition - Little or no mainten	ance required		
Notes: Blvd Entr	ance Road, Standir	ng Curb		A A A A A A A A A A A A A A A A A A A	
Auburn Rd				Date:	1/24/2023
From: Garden S	tation Rd	To:	Franklin twp	line	
Segment Length:	1574'	Average Segment Width: 19'		✓ Dbl Yellow Ctr	\square Wht Edge
Overall condition:	9-10 Very Good C	ondition - Little or no mainten	ance required		
Notes:					
		Laboration A. C. Control of Contr		Date:	1/24/2023
Baker Station Rd		_	m		1/24/2023
From: Hepburn	Rd	To:	Rt 1 dead end		
Segment Length:	394'	Average Segment Width: 15'		☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good C	ondition - Little or no mainten	ance required		
Notes:					
Baker Station Road	İ			Date:	1/24/2023
From: Hepburn	Rd	To:	Baltimore Pik	ke	
Segment Length:	3750'	Average Segment Width: 19'		☑ Dbl Yellow Ctr	☑ Wht Edge
Overall condition:	7-8 Good Condition	on - Routine maintenance, crac	ck Sealing and	Minor Patching Nee	ded
Notes:					
				и-	

LONDON GROVE TOWNSHIP DEPARTMENT OF PUBLIC WORKS

Bandon Circle		Date:	1/24/2023
From: Kent Farm Lane	To: Cul-de-Sa	ac	
Segment Length: 135' Average Segment	ent Width: 15'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition - Routine ma	nintenance, crack Sealing	and Minor Patching Nee	eded
Notes:			
Bell Lane		Date:	1/24/2023
From: Auburn Rd	To: cul-de-sa	С	
Segment Length: 270 ¹ Average Segment	ent Width: 23'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good Condition - Little	e or no maintenance requ	iired	
Notes:			
Bellemead Circle		Data	1/24/2023
	Tay Collate se	Date:	1/24/2023
From: Martin Dr	To: Cul-de-sa	<u></u>	
	ent Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition - Routine ma	intenance, crack Sealing	and Minor Patching Nee	eded
Notes: Rolled curb			
Belmont Circle		Date:	1/24/2023
From: Angelica Dr	To: Angelica	Drive	, ,
Segment Length: 1270' Average Segment	ent Width: 20'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good Condition - Little	e or no maintenance requ	iired	
Notes:			
Bently Ln		Date:	1/24/2023
From: Schoolhouse Rd	To: Schoolho	use Rd	
Segment Length: 2454' Average Segment	ent Width: 24'	\Box Dbl Yellow Ctr	\square Wht Edge
Overall condition: 7-8 Good Condition - Routine ma	aintenance, crack Sealing	and Minor Patching Nee	eded
Notes:			

DEPARTMENT OF PUBLIC WORKS

Blossom Court		Date:	1/24/2023
From: heather G	rove Ln To: Cul-de-sad		
Segment Length:	276' Average Segment Width: 23'	\square Dbl Yellow Ctr	\square Wht Edge
Overall condition:	5-6 Fair Condition - Crack Sealing, Major Patching, and Pre	servative treatments re	commended
Notes:			
			4 /24 /2022
Bramble Lane		Date:	1/24/2023
From: Schoolhou			□
Segment Length:	2652' Average Segment Width: 23'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing a	and Minor Patching Nee	eded
Notes:			
Breaburn Circle		Date:	1/24/2023
From: Cavershar	n To: Cul-de-sac	S	
Segment Length:	241' Average Segment Width: 19'	\Box Dbl Yellow Ctr	\square Wht Edge
	7-8 Good Condition - Routine maintenance, crack Sealing	and Minor Patching Nee	eded
Notes:			
		D 1	1/24/2023
Briarchase Dr		Date:	1/24/2023
From: Rose Hill F	Rd To: Cul-de-sa		
Segment Length:	882' Average Segment Width: 23'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maintenance requ	ired	
Notes:			
Briarcliff Circle		Date:	1/24/2023
	n To: Cul-de-sa		
From: Cavershar	,,	□ Dbl Yellow Ctr	☐ Wht Edge
Segment Length:	230' Average Segment Width: 19'		_
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing	and Minor Patching Ne	saea
Notes:			

DEPARTMENT OF PUBLIC WORKS

Butternut Lane			Date:	1/24/2023
From: Schoolho	use Rd	To: Cul-de-sac		
Segment Length:	1422'	Average Segment Width: 24'	☐ Dbl Yellow Ctr	\square Wht Edge
Overall condition:	9-10 Very Good	Condition - Little or no maintenance requir	red	
Notes:				
	***************************************	777777111111111111111111111111111111111		4 10 4 10 000
Buttonwood Place			Date:	1/24/2023
From: Buttonwo	ood Dr	To: Cul-de-sac	_	_
Segment Length:	137'	Average Segment Width: 22'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good	Condition - Little or no maintenance requir	red	
Notes:				
Cabot Circle			Data	1/24/2023
	_	7. 0.1.1	Date:	1/24/2023
From: Stanford I		To: Cul-de-sac		
C 1 1	2421	Average Segment Width: 19'	Dbl Yellow Ctr	\M/ht Edge
Segment Length:	212'	Average Jegment Width. 19	— por renow en	— \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\
-		on - Routine maintenance, crack Sealing a		J
-		· ·		J
Overall condition: Notes:		· ·	nd Minor Patching Nee	eded
Overall condition: Notes: Camberwell Dr	7-8 Good Condit	on - Routine maintenance, crack Sealing a	nd Minor Patching Nee	J
Overall condition: Notes: Camberwell Dr From: Indian Rui	7-8 Good Condit	on - Routine maintenance, crack Sealing a To: Indian Run	nd Minor Patching Nee Date:	2ded 1/24/2023
Overall condition: Notes: Camberwell Dr	7-8 Good Condit	on - Routine maintenance, crack Sealing a	nd Minor Patching Nee	eded
Overall condition: Notes: Camberwell Dr From: Indian Run Segment Length:	7-8 Good Condit n Rd 1695'	on - Routine maintenance, crack Sealing a To: Indian Run	nd Minor Patching Nee Date: Rd Dbl Yellow Ctr	2ded 1/24/2023 □ Wht Edge
Overall condition: Notes: Camberwell Dr From: Indian Run Segment Length:	7-8 Good Condit n Rd 1695'	on - Routine maintenance, crack Sealing a To: Indian Run Average Segment Width: 20'	nd Minor Patching Nee Date: Rd Dbl Yellow Ctr	2ded 1/24/2023 □ Wht Edge
Overall condition: Notes: Camberwell Dr From: Indian Rui Segment Length: Overall condition: Notes:	7-8 Good Condit n Rd 1695'	on - Routine maintenance, crack Sealing a To: Indian Run Average Segment Width: 20'	nd Minor Patching Nee Date: Rd Dbl Yellow Ctr nd Minor Patching Nee	1/24/2023 Wht Edge
Overall condition: Notes: Camberwell Dr From: Indian Rui Segment Length: Overall condition: Notes: Castlerea Rd	7-8 Good Condit n Rd 1695' 7-8 Good Condit	To: Indian Run Average Segment Width: 20' on - Routine maintenance, crack Sealing a	nd Minor Patching Nee Date: Rd Dbl Yellow Ctr	2ded 1/24/2023 □ Wht Edge
Overall condition: Notes: Camberwell Dr From: Indian Run Segment Length: Overall condition: Notes: Castlerea Rd From: Inniscrone	7-8 Good Condit n Rd 1695' 7-8 Good Condit e Dr	To: Indian Run Average Segment Width: 20' on - Routine maintenance, crack Sealing a	nd Minor Patching Nee Date: Rd Dbl Yellow Ctr nd Minor Patching Nee Date:	1/24/2023 Wht Edge eded 1/24/2023
Overall condition: Notes: Camberwell Dr From: Indian Run Segment Length: Overall condition: Notes: Castlerea Rd From: Inniscrone Segment Length:	7-8 Good Condition Rd 1695' 7-8 Good Condition Dr 1197'	To: Indian Run Average Segment Width: 20' on - Routine maintenance, crack Sealing a To: Cul-de-sac Average Segment Width: 20'	Date: Rd Dbl Yellow Ctr nd Minor Patching Nee Date:	1/24/2023 Wht Edge eded 1/24/2023
Overall condition: Notes: Camberwell Dr From: Indian Run Segment Length: Overall condition: Notes: Castlerea Rd From: Inniscrone Segment Length:	7-8 Good Condition Rd 1695' 7-8 Good Condition Dr 1197'	To: Indian Run Average Segment Width: 20' on - Routine maintenance, crack Sealing a	Date: Rd Dbl Yellow Ctr nd Minor Patching Nee Date:	1/24/2023 Wht Edge eded 1/24/2023

DEPARTMENT OF PUBLIC WORKS

From: McKean Circle Segment Length: 1905' Average Segment Width: 19' Dbl Yellow Ctr Overall condition: 9-10 Very Good Condition - Little or no maintenance required Notes: Blvd Enterance Celia Court Celia Court Abby Rd To: Cul-De-Sac Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Overall condition: 9-10 Very Good Condition - Little or no maintenance required Notes:
Overall condition: 9-10 Very Good Condition - Little or no maintenance required Notes: Blvd Enterance Celia Court Date: 1/24/2023 From: Abby Rd To: Cul-De-Sac Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Wht Edge Overall condition: 9-10 Very Good Condition - Little or no maintenance required
Notes: Blvd Enterance Celia Court Date: 1/24/2023 From: Abby Rd To: Cul-De-Sac Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Wht Edge Overall condition: 9-10 Very Good Condition - Little or no maintenance required
Celia Court Date: 1/24/2023 From: Abby Rd To: Cul-De-Sac Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Wht Edge Overall condition: 9-10 Very Good Condition - Little or no maintenance required
From: Abby Rd To: Cul-De-Sac Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Wht Edge Overall condition: 9-10 Very Good Condition - Little or no maintenance required
From: Abby Rd Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Wht Edge Overall condition: 9-10 Very Good Condition - Little or no maintenance required
Segment Length: 1526' Average Segment Width: 20' Dbl Yellow Ctr Wht Edge Overall condition: 9-10 Very Good Condition - Little or no maintenance required
Overall condition: 9-10 Very Good Condition - Little or no maintenance required
Notes:
Chambers Road Date: 1/24/2023
Clidifibers road
Total Vallani Cha D Whit Edge
Segment Length. 615
Overall condition: 9-10 Very Good Condition - Little or no maintenance required
Notes:
Chambers Way Date: 1/24/2023
From: State Rd To: West Grove Borough
Segment Length: 299' Average Segment Width: 18' Dbl Yellow Ctr Wht Edge
Segment Length. 255 , was age of grown and a segment to the part to the sead of
Notes:
Chartwell Date: 1/24/2023
From: Welcome Ave To: Welcome Ave
Segment Length: 1192' Average Segment Width: 24' Dbl Yellow Ctr Wht Edge
Overall condition: 7-8 Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed
Notes: Rolled curb

DEPARTMENT OF PUBLIC WORKS

Chatham Chase Dr	Date:	1/24/2023
From: E. London Grove Rd	To: Hunter Creek Dr	
Segment Length: 308' Average S	egment Width: 24'	Wht Edge
Overall condition: 9-10 Very Good Condition -	Little or no maintenance required	
Notes: BLVD Entrance		
Cl I All	Data	4/24/2022
Church Alley	Date:	1/24/2023
From: Chatham Rd	To: Pennock Lane	_
Segment Length: 692' Average S	egment Width: 12' Dbl Yellow Ctr	[∐] Wht Edge
Overall condition: 5-6 Fair Condition - Crack Se	aling, Major Patching, and Preservative treatments reco	mmended
Notes:		
Church Alley	Date:	1/24/2023
From: Gap Newport Pike	To: Chatham Rd	
		Wht Edge
Segment Length: 802' Average S	egment Width: 13' 📙 Dbl Yellow Ctr 📙	- vviit cage
	egment Width: 13' \square Dbi Yellow Ctr \square	Ü
		Ü
Overall condition: 5-6 Fair Condition - Crack Se Notes:		Ü
Overall condition: 5-6 Fair Condition:- Crack Se Notes: Clay Creek Rd	aling, Major Patching, and Preservative treatments recor	mmended
Overall condition: 5-6 Fair Condition:- Crack Se Notes: Clay Creek Rd From: Sullivan Rd	Date: To: Garden Station Rd	mmended
Overall condition: 5-6 Fair Condition:- Crack Se Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S	Date: To: Garden Station Rd egment Width: 20'	mmended 1/24/2023 Wht Edge
Overall condition: 5-6 Fair Condition:- Crack Set Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S Overall condition: 7-8 Good Condition - Routing	Date: To: Garden Station Rd	mmended 1/24/2023 Wht Edge
Overall condition: 5-6 Fair Condition:- Crack Se Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S	Date: To: Garden Station Rd egment Width: 20'	mmended 1/24/2023 Wht Edge
Overall condition: 5-6 Fair Condition:- Crack Set Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S Overall condition: 7-8 Good Condition - Routing	Date: To: Garden Station Rd egment Width: 20'	mmended 1/24/2023 Wht Edge
Overall condition: 5-6 Fair Condition:- Crack Set Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S Overall condition: 7-8 Good Condition - Routin Notes:	Date: To: Garden Station Rd egment Width: 20' Emaintenance, crack Sealing and Minor Patching Neede	mmended 1/24/2023 Wht Edge
Overall condition: 5-6 Fair Condition:- Crack Set Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S Overall condition: 7-8 Good Condition - Routin Notes: Clay Creek Rd From: Sullivan Road	Date: To: Garden Station Rd egment Width: 20' Dbi Yellow Ctr e maintenance, crack Sealing and Minor Patching Needer Date: Date: To: East Avondale Rd	mmended 1/24/2023 Wht Edge
Overall condition: 5-6 Fair Condition:- Crack Set Notes: Clay Creek Rd From: Sullivan Rd Segment Length: 3802' Average S Overall condition: 7-8 Good Condition - Routin Notes: Clay Creek Rd From: Sullivan Road Segment Length: 2330' Average S	Date: To: Garden Station Rd egment Width: 20' Dbi Yellow Ctr e maintenance, crack Sealing and Minor Patching Needer Date: Date:	1/24/2023 Wht Edge 1/24/2023

DEPARTMENT OF PUBLIC WORKS

Clay Creek Rd		Date:	1/24/2023
From: Garden St	ration Rd To: F	To: Franklin twp line	
Segment Length:	860' Average Segment Width: 19'	✓ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack	Sealing and Minor Patching Need	ded
Notes:			
		Date	1/24/2023
Clay Creek Rd		Date:	1/24/2023
From: Avondale	Rd To: A	Avondale Borough Line	FT3 1
Segment Length:	5068' Average Segment Width: 20'	☑ Dbl Yellow Ctr	☑ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack	Sealing and Minor Patching Nee	ded
Notes:	·		
Conrey Trail		Date:	1/24/2023
From: Lamborn	Ridge Dr To: C	Cul-de-sac	
Segment Length:	896' Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
•	7-8 Good Condition - Routine maintenance, crack	Sealing and Minor Patching Nee	ded
	7-8 GOOD CONGRION - NOUTINE Haintenance, craci	Cocaming and immerit account of the	
Notes:			
Coote Dr		Date:	1/24/2023
From: Inniscron	e Dr To: I	nniscrone Dr	
Segment Length:	910' Average Segment Width: 19'	☐ Dbi Yellow Ctr	☐ Wht Edge
Overall condition:		nce required	
	·	·	
Notes: Rolled Cu	II B		
Deer Path		Date:	1/24/2023
From: Welcome	Ave To: 0	cul-de-sac	
Segment Length:	509' Average Segment Width: 23'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	5-6 Fair Condition - Crack Sealing, Major Patching	g, and Preservative treatments re	commended
Notes:			

DEPARTMENT OF PUBLIC WORKS

Denise D	r				Date:	1/24/2023
From:	Abby Rd		To: A	Abby Rd		
Segment	Length:	1065'	Average Segment Width: 20'		\square Dbl Yellow Ctr	\square Wht Edge
Overall co	ondition:	9-10 Very Good (Condition - Little or no maintena	nce required		
Notes:						
			VIII			
Dingee R					Date:	1/24/2023
From:	State Rd		To: C	Dead End		
Segment	Length:	556 ^t	Average Segment Width: 14'		☐ Dbl Yellow Ctr	☐ Wht Edge
Overall co	ondition:	5-6 Fair condition	n-Crack Sealing,Major Patching, a	and Preservat	live treatments reco	mmended
Notes:	<u></u>					
Dylan Cir	cle				Date:	1/24/2023
-	Martin Dr		To: C	Cul-de-Sac		
Segment	Length:	268'	Average Segment Width: 20'	-	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall co	ondition:	7-8 Good Conditi	on - Routine maintenance, crack	Sealing and	Minor Patching Nee	ded
Notes:	Rolled Cur	·b				
		1.0	A POLICE AND A POL			
Eagle Cot	urt				Date:	1/24/2023
From:	Whitestor	ne Rd	To: C	Cul-De-sac		
Segment	Length:	215'	Average Segment Width: 20'		☐ Dbl Yellow Ctr	☐ Wht Edge
Overall co	ondition:	7-8 Good Conditi	on - Routine maintenance, crack	Sealing and	Minor Patching Nee	ded
Notes:	Rolled cur	b				
Easkey La	ine				Date:	1/24/2023
·	Elphin Rd		To: (Cul-de-sac		, ,
	·	11001		our ue sae	☐ Dbl Yellow Ctr	☐ Wht Edge
Segment	_	11831	Average Segment Width: 19'			J
			on - Routine maintenance, crack	Sealing and	Minor Patching Nee	ded
Notes:	Roller Cur	b 				

DEPARTMENT OF PUBLIC WORKS

ROAD SURVEY

1/24/2023 Date: East Avondale Rd To: Clay Creek Rd From: Rosehill Rd Average Segment Width: 20' ☑ Dbl Yellow Ctr ✓ Wht Edge Segment Length: 4216' Overall condition: 7-8 Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed Notes: 1/24/2023 Date: East Avondale Rd To: Schoolhouse Rd From: Garden Station Rd ✓ Dbl Yellow Ctr ✓ Wht Edge Average Segment Width: 20' Segment Length: 760' Overall condition: 9-10 Very Good Condition - Little or no maintenance required Notes: Date: 1/24/2023 East Avondale Rd To: Wickerton Rd Schoolhouse Rd From: Dbl Yellow Ctr ☑ Wht Edge Average Segment Width: 20' Segment Length: 2143' Overall condition: 5-6 Fair Condition - Crack Sealing, Major Patching, and Preservative treatments recommended Notes: 1/24/2023 Date: East Avondale Rd To: Garden Station Rd Rosehill Rd From: ☑ Dbl Yellow Ctr ☑ Wht Edge Segment Length: 30751 Average Segment Width: 20' Overall condition: 7-8 Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed Notes: 1/24/2023 East Avondale Rd Date: To: S. Guernsey Rd From: Wickerton Rd ☑ Dbl Yellow Ctr Average Segment Width: 20' Segment Length: 3715' Overall condition: 7-8 Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed Notes:

DEPARTMENT OF PUBLIC WORKS

East Hunter Creek Dr		Date:	1/24/2023
From: Chatham Chase Dr	To: Cul-de-	-Sac	
Segment Length: 808'	Average Segment Width: 22'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good G	Condition - Little or no maintenance re	quired	
Notes:			
C-th-day Cuay Dd		Date:	1/24/2023
East London Grove Rd	Tar. Laustia		1/24/2023
From: Spencer Rd	To: Lambo	_	
Segment Length: 2200'	Average Segment Width: 20'	☑ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good (Condition - Little or no maintenance re	quired	
Notes:			
East London Grove Rd		Date:	1/24/2023
From: Lamborntown Rd	To: Howell	l Moore Rd	
Segment Length: 4750'	Average Segment Width: 19'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good (Condition - Little or no maintenance re	quired	
Notes:			
East London Grove Rd		Date:	1/24/2023
			1,24,2023
From: Howell Moore Rd	To: Coastv		
Segment Length: 2807'	Average Segment Width: 19'	☑ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good (Condition - Little or no maintenance re	equired	
Notes:			
Eaton circle		Date:	1/24/2023
From: Kent Farm Lane	To: Cul-de-	-sac	
Segment Length: 130'	Average Segment Width: 15'	☐ Dbl Yellow Ctr	☐ Wht Edge
-	ion - Routine maintenance, crack Seali	ng and Minor Patching Nee	- eded
Notes:	·	- -	

LONDON GROVE TOWNSHIP DEPARTMENT OF PUBLIC WORKS

Edna Jane Lane		Date:	1/24/2023
From: Lamborn (Ridge Dr To: Cul-de-Sac		
Segment Length:	2165' Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing and	Minor Patching Nee	ded
Notes:			
10-11			4 /24 /2022
Ellicott Rd		Date:	1/24/2023
From: Star Rd	To: Garden Statio		
Segment Length:	560' Average Segment Width: 20'	☑ Dbl Yellow Ctr	✓ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing and	l Minor Patching Nee	ded
Notes:		///	
Ellicott Rd		Date:	1/24/2023
From: Garden St	ation Rd To: Cooper Rd		
Segment Length:	999' Average Segment Width: 20'	☑ Dbl Yellow Ctr	☑ Wht Edge
_	7-8 Good Condition - Routine maintenance, crack Sealing and	l Minor Patching Nee	ded
	7-8 GOOG CONDITION - ROUTING Maintenance, cruck seaming and		
Notes:			
Ellicott Rd		Date:	1/24/2023
From: Cooper Ro	To: Bridge @ Ne	w Garden	
Segment Length:	1624' Average Segment Width: 20'	☑ Dbl Yellow Ctr	☑ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing and	d Minor Patching Nee	ded
Notes:			
4-20			
Elphin Rd		Date:	1/24/2023
From: State Rd	To: Aringa Way		
Segment Length:	1551' Average Segment Width: 19'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing and	d Minor Patching Nee	eded
Notes: Rolled Cu	rb		

DEPARTMENT OF PUBLIC WORKS

Finn Way		Date:	1/24/2023
From: Inniscrone Dr	To: Cul-de-sac		
Segment Length: 468' Av	verage Segment Width: 19'	\square Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good Con	dition - Little or no maintenance required		
Notes: Rolled Curb			
		Data	1/24/2023
Flintlock Circle		Date:	1/24/2023
From: Kent Farm Lane	To: Cul-de-sac		
Segment Length: 239' Av	verage Segment Width: 15'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition	- Routine maintenance, crack Sealing and	Minor Patching Nee	ded
Notes:			
Franklin Court		Date:	1/24/2023
From: Truman Lane	To: Cul-de-Sac		
Segment Length: 260' Av	verage Segment Width: 20'	☐ Dbl Yellow Ctr	\square Wht Edge
Overall condition: 9-10 Very Good Con	dition - Little or no maintenance required		
Notes:			
			1/24/2022
Friendship Lane		Date:	1/24/2023
From: Angelica Dr	To: Clay Creek Ro		
Segment Length: 535' Av	verage Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good Con	dition - Little or no maintenance required		
Notes:			
Garden Station Rd		Date:	1/24/2023
	To: East Avondal		2, 2 , 2
·			Manus est-
	verage Segment Width: 20'	☑ Dbl Yellow Ctr	₩ wnt eage
Overall condition: 9-10 Very Good Cor	dition - Little or no maintenance required		
Notes:			

DEPARTMENT OF PUBLIC WORKS

Garden Station Rd		Date:	1/24/2023
From: Clay Creek Rd	To: Roosevelt w	ray	
Segment Length: 4111	Average Segment Width: 20'	☑ Dbi Yellow Ctr	✓ Wht Edge
Overall condition: 7-8 Go	ood Condition - Routine maintenance, crack Sealing an	d Minor Patching Nee	ded
Notes:			
			4/24/2022
Garden Station Rd		Date:	1/24/2023
From: Ellicott Rd	To: Clay Creek F		
Segment Length: 1265'	Average Segment Width: 20'	☑ Dbl Yellow Ctr	☑ Wht Edge
Overall condition: 7-8 Go	ood Condition - Routine maintenance, crack Sealing an	d Minor Patching Nee	ded
Notes:			
Glen Iris Court		Date:	1/24/2023
	To: Cul-de-sac	•	
	Average Segment Width: 20'	Dbl Yellow Ctr	☐ Wht Edge
Segment Length: 202'			<u> </u>
	/ery Good Condition - Little or no maintenance require	eu	
Notes:			
Glen Willow Rd		Date:	1/24/2023
From: Woodview Rd	To: Gap Newpo	rt Pike	
Segment Length: 7686'	Average Segment Width: 19'	☑ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 G	ood Condition - Routine maintenance, crack Sealing ar	nd Minor Patching Nee	eded
Notes: Bridge Out			
			1/24/2023
Gouge Blvd		Date:	1/24/2025
From: S. Guernsey Rd	To: Grace Lane	·	F7
Segment Length: 615'	Average Segment Width: 20 ¹	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 G	ood Condition - Routine maintenance, crack Sealing ar	nd Minor Patching Nec	eded
Notes: Blvd entrance			

DEPARTMENT OF PUBLIC WORKS

Grace Lane		Date:	1/24/2023
From: Gouge Blvd	d To: cul-d	e-sac	
Segment Length:	422' Average Segment Width: 20'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sea	aling and Minor Patching Nee	ded
Notes:			
Currential terre		Date:	1/24/2023
Greenfield Lane			1,24,2023
From: N. Guernse			
Segment Length:	1173' Average Segment Width: 24'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maintenance	required	
Notes:			
Hammersmith Court	t	Date:	1/24/2023
From: Camberwe	ell Dr To: Cul-c	le-sac	
Segment Length:	293' Average Segment Width: 19'	☐ Dbl Yellow Ctr	\square Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sea	aling and Minor Patching Nee	eded
Overall condition: Notes:	7-8 Good Condition - Routine maintenance, crack Sea	aling and Minor Patching Nee	eded
Notes:	7-8 Good Condition - Routine maintenance, crack Sea	TO NEW YORK IN	
Notes: Hannum Mill Rd		Date:	eded 1/24/2023
Notes: Hannum Mill Rd From: Coastville f	Rd To: Dead	Date:	1/24/2023
Notes: Hannum Mill Rd From: Coastville & Segment Length:	Rd To: Dead 1480' Average Segment Width: 14'	Date: d End □ Dbl Yellow Ctr	
Notes: Hannum Mill Rd From: Coastville & Segment Length:	Rd To: Dead	Date: d End □ Dbl Yellow Ctr	1/24/2023
Notes: Hannum Mill Rd From: Coastville & Segment Length:	Rd To: Dead 1480' Average Segment Width: 14'	Date: d End □ Dbl Yellow Ctr	1/24/2023
Notes: Hannum Mill Rd From: Coastville (Segment Length: Overall condition:	Rd To: Dead 1480' Average Segment Width: 14' 9-10 Very Good Condition - Little or no maintenance	Date: d End □ Dbl Yellow Ctr	1/24/2023
Notes: Hannum Mill Rd From: Coastville for Segment Length: Overall condition: Notes:	Rd To: Dead 1480' Average Segment Width: 14' 9-10 Very Good Condition - Little or no maintenance	Date: d End ☐ Dbl Yellow Ctr required Date:	1/24/2023
Notes: Hannum Mill Rd From: Coastville for Segment Length: Overall condition: Notes: Heatherbrook Court From: Chamberw	Rd To: Dead 1480' Average Segment Width: 14' 9-10 Very Good Condition - Little or no maintenance	Date: d End ☐ Dbl Yellow Ctr required Date:	1/24/2023
Notes: Hannum Mill Rd From: Coastville for Segment Length: Overall condition: Notes: Heatherbrook Court From: Chamberw Segment Length:	Rd To: Dead 1480' Average Segment Width: 14' 9-10 Very Good Condition - Little or no maintenance t vell Dr To: Cul-o	Date: d End Dbl Yellow Ctr required Date: de-sac Dbl Yellow Ctr	1/24/2023 Wht Edge 1/24/2023

DEPARTMENT OF PUBLIC WORKS

Heathergrove Lane		Date:	1/24/2023
From: Welcome Ave	To: State Rd		
Segment Length: 1446' Average Segment Widt	h: 23'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 5-6 Fair Condition - Crack Sealing, Major I	Patching, and Prese	rvative treatments re	commended
Notes:			
			4 10 4 10 000
Hepburn Rd		Date:	1/24/2023
From: Gap Newport Pike	To: London Grov		r
Segment Length: 1418' Average Segment Widt	h: 35'	☑ Dbl Yellow Ctr	☑ Wht Edge
Overall condition: 7-8 Good Condition - Routine maintenance	ce, crack Sealing and	d Minor Patching Nee	ded
Notes: Traffic Circle. Bboulevard enterance. Note traffic ci	rcle 5-6	· A 56-11190-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1	
Hepburn Rd		Date:	1/24/2023
From: London Grove Village	To: Baker Statio	n Rd	
Segment Length: 1226' Average Segment Widt	h: 20'	☑ Dbl Yellow Ctr	✓ Wht Edge
Overall condition: 7-8 Good Condition - Routine maintenance	ce, crack Sealing and	d Minor Patching Nee	ded
Notes:			
Hilltop Rd		Date:	1/24/2023
From: Garden Station Rd	To: Franklin Tw) Line	
Segment Length: 945' Average Segment Widt	h: 17¹	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition - Routine maintenance	ce, crack Sealing an	d Minor Patching Nee	eded
Notes:			
Hilton Rd		Date:	1/24/2023
From: N. Guernsey Rd	To: Walter Rd		
Segment Length: 3170' Average Segment Widt	h: 16'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition - Routine maintenance	ce, crack Sealing an	d Minor Patching Nee	eded
Notes:			

DEPARTMENT OF PUBLIC WORKS

e
/2022
/2022
/2022
12023
e
/2023
e
_
/2023
1/2023
1/2023 e
e
e
e 1/2023
1

DEPARTMENT OF PUBLIC WORKS

Indian Run Rd		Date:	1/24/2023
From: Clay Creek Rd	To: Avono	dale Borough	
Segment Length: 4858	Average Segment Width: 17'	✓ Dbl Yellow Ctr	☑ Wht Edge
Overall condition: 9-10 Very Good C	ondition - Little or no maintenance r	required	
Notes: width and striping vary signi	ficantly		
		Date:	1/24/2023
Inniscrone Dr	T		1,24,2023
From: East Avondale Rd	To: State		M Mht Edmo
Segment Length: 4198'	Average Segment Width: 24'	✓ Dbl Yellow Ctr	✓ Wht Edge
Overall condition: 9-10 Very Good C	ondition - Little or no maintenance r	required	
Notes: Rolled Curb			
Jack Reynolds Way		Date:	1/24/2023
From: Garden Station Rd	To: Cul-d	e-sac	
Segment Length: 1463'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good C			
	Officially - Little of no maintenance i		
Notes: Some Standing Curb			
Jamison Circle		Date:	1/24/2023
From: McKean Circle	To: Cul-d	e-sac	
Segment Length: 392'	Average Segment Width: 19'	Dbl Yellow Ctr	\square Wht Edge
_	on - Routine maintenance, crack Sea	ling and Minor Patching Nee	ded
Notes:			
	AND		
Jay Crossing		Date:	1/24/2023
From: State Rd	To; Mart	has Way	
Segment Length: 442'	Average Segment Width: 35'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Conditi	on - Routine maintenance, crack Sea	aling and Minor Patching Nee	ded
Notes: BLVD Entrance			

DEPARTMENT OF PUBLIC WORKS

John Wilson Circle		Date:	1/24/2023
From: Marthas Way	To: Marthas W	Vay	
Segment Length: 457' Average Segment	Width: 15'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition - Routine maint	enance, crack Sealing a	and Minor Patching Nee	eded
Notes:			
Joyce Circle	AND THE PROPERTY OF THE PROPER	Date:	1/24/2023
From: Martin Dr	To: Cul-de-sac	:	
Segment Length: 528' Average Segment	:Width: 20'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8 Good Condition - Routine maint	enance, crack Sealing a	and Minor Patching Nee	eded
Notes: Rolled Curb		-200000-0	
Kent Farm Lane		Date:	1/24/2023
From: N. Guernsey Rd	To: Cul-de-sac	:	
Segment Length: 1271' Average Segment	Width: 18'	☐ Dbl Yellow Ctr	\square Wht Edge
Overall condition: 7-8 Good Condition - Routine maint	enance, crack Sealing a	and Minor Patching Ne	eded
Notes:	**************************************		
Kodi Circle		Date:	1/24/2023
From: Abby Rd	To: Kodi Circle	2	
Segment Length: 1240' Average Segment	: Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very Good Condition - Little or	no maintenance requi	red	
Notes: BLVD Entrance		, 100 k	PARAMETERS AND ASSESSMENT AND ASSESSMENT ASS
Lake Rd		Date:	1/24/2023
From: Baltimore Pike	To: Baltimore	Pike	
Segment Length: 3852' Average Segment	: Width: 17'	☑ Dbi Yellow Ctr	\square Wht Edge
Overall condition: 9-10 Very Good Condition - Little or	no maintenance requi	red	
Notes:			

DEPARTMENT OF PUBLIC WORKS

Lake Rd		Date:	1/24/2023
From: Baltimore Pike	ke To: Baker St	ation Rd	
Segment Length: 393	Average Segment Width: 18'	✓ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-1	10 Very Good Condition - Little or no maintenance req	uired	
Notes:			
			4 10 4 10 00 2
Lakenheath Court		Date:	1/24/2023
From: Cul-de-sac	To: Cul-de-s	ac	
Segment Length: 65	Average Segment Width: 19'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 7-8	8 Good Condition - Routine maintenance, crack Sealing	g and Minor Patching Nee	ded
Notes:			
Lamborn Ridge Dr		Date:	1/24/2023
From: State Rd	To: South G	uernsey Rd	
	OO8' Average Segment Width: 20'	Dbl Yellow Ctr	☐ Wht Edge
	8 Good Condition - Routine maintenance, crack Sealing	g and Minor Patching Nee	ded
		B a 0	
Notes: BLVD Entranc	ce		
Lamborntown Rd		Date:	1/24/2023
From: E. London Gro	rove Rd To: Street R	td	
Segment Length: 50	008' Average Segment Width: 15'	☐ Dbl Yellow Ctr	\square Wht Edge
"	-10 Very Good Condition - Little or no maintenance rec	quired	
Notes:	,		
Motes.			
Letchworth Lane		Date:	1/24/2023
From: Angelica Dr	To: Angelica	a Dr	
Segment Length: 20	015' Average Segment Width: 20'	Dbl Yellow Ctr	\square Wht Edge
	-10 Very Good Condition - Little or no maintenance rec	quired	
Notes:			

DEPARTMENT OF PUBLIC WORKS

	Date:	1/24/2023
Lakenheath (Court	•
	Dbl Yellow Ctr	\square Wht Edge
k Sealing and	d Minor Patching Nee	eded
	Date:	1/24/2023
Chatham Rd		
	☑ Dbl Yellow Ctr	☐ Wht Edge
ance required	d	
	Date:	1/24/2023
cul-de-sac		
cul-de-sac	☐ Dbl Yellow Ctr	☐ Wht Edge
	☐ Dbl Yellow Ctr	J
		J
		J
	d Minor Patching Nee	eded
ck Sealing and	d Minor Patching Nee	eded
ck Sealing and	d Minor Patching Nee	1/24/2023
ck Sealing and	Date:	1/24/2023
ck Sealing and	Date:	1/24/2023
ck Sealing and	d Minor Patching Nee Date: Dbl Yellow Ctr d Minor Patching Nee Date:	1/24/2023 Wht Edge
ck Sealing and Cul-de-sac	d Minor Patching Nee Date: Dbl Yellow Ctr d Minor Patching Nee Date:	1/24/2023 Wht Edge
ck Sealing and Cul-de-sac ck Sealing and South Guern	d Minor Patching Nee Date: Dbl Yellow Ctr d Minor Patching Nee Date:	1/24/2023 Wht Edge 2/24/2023
	ck Sealing and	Date: Chatham Rd Dbl Yellow Ctr ance required

DEPARTMENT OF PUBLIC WORKS

Martin Dr		Date:	1/24/2023
From: Avondale Rd	To:	Bellemead Circle	
Segment Length: 3003	' Average Segment Width: 20'	☐ Dbl Yellow	Ctr 🗆 Wht Edge
Overall condition: 7-8 G	ood Condition - Routine maintenance, crac	ck Sealing and Minor Patching	Needed
Notes: Rolled Curb			
Mary Ann Court		Date:	1/24/2023
From: Lamborn Ridge	Dr To:	Lamborn Ridge Dr	
Segment Length: 385'	Average Segment Width: 20'	Dbl Yellow	Ctr
Overall condition: 9-10	Very Good Condition - Little or no mainten	ance required	
Notes:			
McCue Rd		Date:	1/24/2023
From: New Garden To	wnship To:	Spencer Rd	
Segment Length: 3513		☑ Dbl Yellow	Ctr 🗆 Wht Edge
Overall condition: 9-10	Very Good Condition - Little or no mainten	ance required	
Notes:	,		
McKean Circle		Date:	1/24/2023
From: Schoolhouse Rd	To:	Caversham Dr	
Segment Length: 715'	Average Segment Width: 19	□ Dbl Yellow	Ctr 🗆 Wht Edge
-	ood Condition - Routine maintenance, crac		Needed
Notes:	•		
Meadow Woods Lane		Date:	1/24/2023
From: State Rd	То:	Cul-de-sac	
Segment Length: 838'	Average Segment Width: 23	☐ Dbl Yellow	Ctr 🗆 Wht Edge
Overall condition: 7-8 G	ood Condition - Routine maintenance, crac	ck Sealing and Minor Patching	Needed
Notes:			

DEPARTMENT OF PUBLIC WORKS

Meetinghouse Rd			Date:	1/24/2023
From: West Grove	e Boro	To: Dead End	I	
Segment Length: 4	171' Average Se	gment Width: 14'	\square Dbl Yellow Ctr	\square Wht Edge
Overall condition: 7	7-8 Good Condition - Routine	maintenance, crack Sealing	and Minor Patching Nee	eded
Notes:				
AA:		A AMARONA MARKATANA	Data	1/24/2023
Misty Hallow Rd		···	Date:	1/24/2023
From: Chatham Ro	1	To: dead end		
Segment Length: 5	506' Average Se	gment Width: 15'	Dbl Yellow Ctr	□ Wht Edge
Overall condition: 5	5-6 Fair Condition - Crack Sea	lling, Major Patching, and Pre	eservative treatments re	commended
Notes:				
Moorings Rd			Date:	1/24/2023
From: Radance La	ne	To: cul-de-sa	c .	
Segment Length: 5	Average Se	gment Width: 20'	\square Dbl Yellow Ctr	☐ Wht Edge
			and Minar Databing Nos	dad
Overall condition: 7	7-8 Good Condition - Routine	maintenance, crack Sealing	and Minor Patering Nee	deu
Overall condition: 7 Notes:	7-8 Good Condition - Routine	e maintenance, crack Sealing	and winor Patering Nee	
	7-8 Good Condition - Routine	e maintenance, crack Sealing	Date:	1/24/2023
Notes:	7-8 Good Condition - Routine	To: Gap New	Date:	
Notes: Mosquito Lane From: Street Rd			Date:	
Mosquito Lane From: Street Rd Segment Length: 3	3524' Average Se	To: Gap New	Date: port Pike Dbl Yellow Ctr	1/24/2023
Mosquito Lane From: Street Rd Segment Length: 3	3524' Average Se	To: Gap New gment Width: 14'	Date: port Pike Dbl Yellow Ctr	1/24/2023
Notes: Mosquito Lane From: Street Rd Segment Length: 3 Overall condition: 5 Notes:	3524' Average Se	To: Gap New gment Width: 14'	Date: port Pike □ Dbl Yellow Ctr eservative treatments re	1/24/2023
Mosquito Lane From: Street Rd Segment Length: 3 Overall condition: 5	3524' Average Se	To: Gap New gment Width: 14'	Date: port Pike Dbl Yellow Ctr	1/24/2023
Notes: Mosquito Lane From: Street Rd Segment Length: 3 Overall condition: 5 Notes:	3524' Average Se 3-6 Fair Condition - Crack Sea	To: Gap New gment Width: 14'	Date: port Pike Dbl Yellow Ctr eservative treatments re Date:	1/24/2023
Notes: Mosquito Lane From: Street Rd Segment Length: 3 Overall condition: 5 Notes: Nathan Place From: Marthas Wa	3524' Average Se 5-6 Fair Condition - Crack Sea	To: Gap New gment Width: 14' Iling, Major Patching, and Pre	Date: port Pike Dbl Yellow Ctr eservative treatments re Date:	1/24/2023
Mosquito Lane From: Street Rd Segment Length: 3 Overall condition: 5 Notes: Nathan Place From: Marthas Wa Segment Length: 4	3524' Average Se 3-6 Fair Condition - Crack Sea ay 126' Average Se	To: Gap New gment Width: 14' Iling, Major Patching, and Pre To: Marthas	Date: port Pike Dbl Yellow Ctr eservative treatments re Date: Way Dbl Yellow Ctr	1/24/2023 Wht Edge ecommended 1/24/2023

DEPARTMENT OF PUBLIC WORKS

Nelson Rd		Date:	1/24/2023
From: Gouge Blv	rd To: cul-de-sac		
Segment Length:	623' Average Segment Width: 20'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing an	d Minor Patching Nee	ded
Notes:			
			4/24/2022
New Covenant Cou		Date:	1/24/2023
From: Indian Ru	n Rd To; Cul-de-sac		
Segment Length:	668' Average Segment Width: 19'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing an	d Minor Patching Nee	ded
Notes:			
Newfield Court		Date:	1/24/2023
	Srove In To: Cul-de-sac		
	nove in	☐ Dbl Yellow Ctr	☐ Wht Edge
Segment Length:			J
Overall condition:	5-6 Fair Condition - Crack Sealing, Major Patching, and Prese	sivative treatments re	commenaea
Notes:			
Newton Circle		Date:	1/24/2023
From: Stanford	Dr To: Cul-de-sac		
	744' Average Segment Width: 19'	☐ Dbl Yellow Ctr	☐ Wht Edge
Segment Length:	7-8 Good Condition - Routine maintenance, crack Sealing ar	nd Minor Patching Nee	eded
Overall condition:	7-8 Good Condition - noutine maintenance, crack seaming as		
Notes:			
Nottingham Dr		Date:	1/24/2023
_	ton Dr To: cul-de-sac		
From: Worthing		☐ Dbl Yellow Ctr	☐ Wht Edge
From: Worthing Segment Length:	1697' Average Segment Width: 24'		_
From: Worthing			_

DEPARTMENT OF PUBLIC WORKS

Nova Lane		Date:	1/24/2023
From: N. Guernsey Ro	To: cul-de-Sac		
Segment Length: 876'	Average Segment Width: 22'	\square Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10	Very Good Condition - Little or no maintenance required		
Notes:			
Oak Ln		Date:	1/24/2023
From: Butternut Ln	To: Schoolhouse		2,2,,0020
		Dbl Yellow Ctr	☐ Wht Edge
Segment Length: 1163			Will Luge
	Very Good Condition - Little or no maintenance required		
Notes:			
Paddock Way		Date:	1/24/2023
From: Radance Lane	To: cul-de-Sac		
Segment Length: 327'	Average Segment Width: 20'	Dbl Yellow Ctr	\square Wht Edge
Overall condition: 7-8 (Good Condition - Routine maintenance, crack Sealing and	Minor Patching Nee	ded
Notes:			
Par Court		Date:	1/24/2023
From: Whitestone Rd	To: Cul-de-Sac		-, - ,,
Segment Length: 243'		☐ Dbl Yellow Ctr	☐ Wht Edge
-	Good Condition - Routine maintenance, crack Sealing and		
	good Condition - Routine maintenance, crack Sealing and	Willion Fatching wee	ded
Notes: Rolled Curb		, ,	
Paschall Mill Rd		Date:	1/24/2023
From: Baltimore Pike	To: Penn Townsh	ip	
Segment Length: 3433	1' Average Segment Width: 19'	☑ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10	Very Good Condition - Little or no maintenance required		
Notes:			
Motes.			

DEPARTMENT OF PUBLIC WORKS

Pennford Circle	Date: 1/24/2023
From: Caversham	To: Cul-de-Sac
Segment Length: 2	1' Average Segment Width: 19' 🗆 Dbl Yellow Ctr 🗀 Wht Edge
Overall condition: 7	Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed
Notes:	
	Date: 1/24/2023
Pennock Rd	
From: Chatham Rd	To: Gap Newport Pike
Segment Length: 6	7' Average Segment Width: 15' \square Dbl Yellow Ctr \square Wht Edge
Overall condition: 7	Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed
Notes:	
Penwyck Lane	Date: 1/24/2023
From: Gap Newpor	Pike To: Cul-de-Sac
•	97' Average Segment Width: 23' Dbl Yellow Ctr Wht Edge
	Poor Condition - Structural Improvements, Leveling, and Overlay, or Recycling recommended
	, , , , , , , , , , , , , , , , , , ,
Notes:	
Prange Rd	Date: 1/24/2023
From: Chatham Rd	To: cul-de-sac
	80' Average Segment Width: 15' 🗆 🗆 Dbl Yellow Ctr 🗀 Wht Edge
-	LO Very Good Condition - Little or no maintenance required
Notes:	
Notes.	
Radence Lane	Date: 1/24/2023
From: W. Avondal	Rd To: Paddock Way
Segment Length: 8	6' Average Segment Width: 35' \square Dbl Yellow Ctr \square Wht Edge
Overall condition: 7	3 Good Condition - Routine maintenance, crack Sealing and Minor Patching Needed

DEPARTMENT OF PUBLIC WORKS

Raymond Ave		Date:	1/24/2023
From: Lake Rd	To: Dead End		
Segment Length: 934'	Average Segment Width: 18'	Dbl Yellow Ctr	\square Wht Edge
Overall condition: 3-4 Poor Co	ondition - Structural Improvements, Leveling, a	nd Overlay, or Recycling	recommended
Notes:			
		D .	4/24/2022
Remington Way		Date:	1/24/2023
From: Schoolhouse Rd	To: Remingto		
Segment Length: 3417'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	□ Wht Edge
Overall condition: 7-8 Good C	ondition - Routine maintenance, crack Sealing	and Minor Patching Nee	ded
Notes: BLVD Entrance			· · · · · · · · · · · · · · · · · · ·
Roosevelt Way		Date:	1/24/2023
From: Garden Station Rd	To: Sullivan C	hase Dr	
Segment Length: 257'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very C	Good Condition - Little or no maintenance requ	ired	
Notes:			
Passaman May		Date:	1/24/2023
Roscoman Way			.1, 24, 2023
From: Castlerea Rd	To: Inniscron		
Segment Length: 472'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very 0	Good Condition - Little or no maintenance requ	ired	
Notes: Rolled Curb			
Roseann Lane		Date:	1/24/2023
From: Chatham Rd	To: Cul-de-sa	r	
	Average Segment Width: 22'	☐ Dbl Yellow Ctr	☐ Wht Edge
Segment Length: 1522'			
	ondition - Routine maintenance, crack Sealing	and Ivilnor Patching Nee	eaea
Notes: First 300' 9-10			

DEPARTMENT OF PUBLIC WORKS

Rosehill Rd		Date:	1/24/2023
From: East Avondale Rd	To: State Rd		
Segment Length: 5101'	Average Segment Width: 20'	✓ Dbl Yellow Ctr	✓ Wht Edge
Overall condition: 5-6 Fair Conditi	on - Crack Sealing, Major Patching, and Pro	eservative treatments re	commended
Notes:			
			1/24/2022
Rosehill Rd		Date:	1/24/2023
From: State Rd	To: West Gro		
Segment Length: 2717'	Average Segment Width: 20'	☑ Dbl Yellow Ctr	✓ Wht Edge
Overall condition: 5-6 Fair Conditi	on - Crack Sealing, Major Patching, and Pro	eservative treatments re	commended
Notes:			
Rouse Dr		Date:	1/24/2023
From: Whitestone Dr	To: Dead End	ł	
	Augrago Cogmont Width: 201	Dbl Yellow Ctr	☐ Wht Edge
Segment Length: 65'	Average Segment Width: 20'	La Doi Tellow Cu	
	ition - Routine maintenance, crack Sealing		•
			•
Overall condition: 7-8 Good Cond Notes: Rolled Curb		and Minor Patching Nee	eded
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr	ition - Routine maintenance, crack Sealing	and Minor Patching Nee	•
Overall condition: 7-8 Good Cond Notes: Rolled Curb		and Minor Patching Nee Date:	1/24/2023
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr	ition - Routine maintenance, crack Sealing	and Minor Patching Nee	eded
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636'	ition - Routine maintenance, crack Sealing To: Whitesto	and Minor Patching Nee Date: one Dr □ Dbi Yellow Ctr	1/24/2023
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636'	ition - Routine maintenance, crack Sealing To: Whitesto Average Segment Width: 20'	and Minor Patching Nee Date: one Dr □ Dbi Yellow Ctr	1/24/2023
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636' Overall condition: 7-8 Good Cond Notes: Rolled Curb	ition - Routine maintenance, crack Sealing To: Whitesto Average Segment Width: 20'	and Minor Patching Nee Date: Date: Dbl Yellow Ctr and Minor Patching Nee	1/24/2023
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636' Overall condition: 7-8 Good Cond Notes: Rolled Curb Rushford Place	To: Whitesto Average Segment Width: 20' ition - Routine maintenance, crack Sealing	and Minor Patching Nee Date: Date: Dbl Yellow Ctr and Minor Patching Nee Date:	1/24/2023 Wht Edge
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636' Overall condition: 7-8 Good Cond Notes: Rolled Curb Rushford Place From: Angellica Dr	To: Whitesto Average Segment Width: 20' ition - Routine maintenance, crack Sealing To: Cul-de-sa	and Minor Patching Nee Date: Date: Dbl Yellow Ctr and Minor Patching Nee Date:	1/24/2023 Wht Edge eded 1/24/2023
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636' Overall condition: 7-8 Good Cond Notes: Rolled Curb Rushford Place From: Angellica Dr Segment Length: 1833'	To: Whitesto Average Segment Width: 20' ition - Routine maintenance, crack Sealing To: Cul-de-sa	Date: Date: Date Dr Dbl Yellow Ctr and Minor Patching Nee Date: Date:	1/24/2023 Wht Edge eded 1/24/2023
Overall condition: 7-8 Good Cond Notes: Rolled Curb Rouse Dr From: Westview Dr Segment Length: 636' Overall condition: 7-8 Good Cond Notes: Rolled Curb Rushford Place From: Angellica Dr Segment Length: 1833'	To: Whitesto Average Segment Width: 20' ition - Routine maintenance, crack Sealing To: Cul-de-sa	Date: Date: Date Dr Dbl Yellow Ctr and Minor Patching Nee Date: Date:	1/24/2023 Wht Edge eded 1/24/2023

DEPARTMENT OF PUBLIC WORKS

DEPARTMENT OF PUBLIC WORKS

Slingo Rd		Date:	1/24/2023
From: Elphin Rd	To: Inniscr	one Dr	
Segment Length:	1701' Average Segment Width: 19'	Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, crack Seali	ing and Minor Patching Nee	ded
Notes: Rolled Cu	ırb		
		Date:	1/24/2023
South Guernsey Ro			1,24,2025
From: State Rd		ore Pike	M Miles Falmo
Segment Length:	3398' Average Segment Width: 19'	☑ Dbl Yellow Ctr	☑ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maintenance re	equired	
Notes: Road Spl	t with West Grove Borough		
C C	J	Date:	1/24/2023
South Guernsey Ro	a To: W.Av		- , ,
From: State Rd		Ondale Nd ☑ Dbl Yellow Ctr	✓ Wht Edge
Segment Length:	4389' Average Segment Width: 20'		witt Lage
Overall condition:	9-10 Very Good Condition - Little or no maintenance r	equired	
Notes:			
Couth Cuarnagy De	4	Date:	1/24/2023
South Guernsey Ro		in township	
From: W. Avon		☑ Dbl Yellow Ctr	☑ Wht Edge
Segment Length:	3620' Average Segment Width: 20'		WINC EUGE
Overall condition:	9-10 Very Good Condition - Little or no maintenance r	equired	
Notes:			
Spencer Rd		Date:	1/24/2023
From: McCue R	d To: West	Marlboro Township	
	1603' Average Segment Width: 18'	☑ Dbl Yellow Ctr	☐ Wht Edge
Segment Length:			Ü
Overall condition:	9-10 Very Good Condition - Little or no maintenance r	суинси	
Notes:			

DEPARTMENT OF PUBLIC WORKS

Standford Rd			Date:	1/24/2023
From: Wickerton	n Rd To	Caversham D	r	
Segment Length:	1731' Average Segment Width:	.9'	☐ Dbl Yellow Ctr	\square Wht Edge
Overall condition:	7-8 Good Condition - Routine maintenance, c	ack Sealing and	Minor Patching Nee	ded
Notes: BLVD Enti	rance			
C		- A	Dut	4/24/2022
State Rd			Date:	1/24/2023
From: Schoolho		Wickerton Ro		
Segment Length:	2486' Average Segment Width: 2	!O¹	✓ Dbl Yellow Ctr	✓ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maint	enance required	l .	
Notes:				
State Rd			Date:	1/24/2023
From: Wickerton	n Rd To	S. Guernsey F	Rd	
Segment Length:	2708' Average Segment Width: 2	0'	☑ Dbl Yellow Ctr	✓ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maint	enance required	I	
Notes:				
State Rd			Date:	1/24/2023
From: S. Guerns	ev Rd To	Penn Townsh	qi	, ,
Segment Length:	3298' Average Segment Width: 2		✓ Dbl Yellow Ctr	✓ Wht Edge
_	9-10 Very Good Condition - Little or no maint			
Notes:				
State Rd			Date:	1/24/2023
From: Rosehill R	d To	Schoolhouse	Rd	
Segment Length:	2500' Average Segment Width: 2	20'	☑ Dbl Yellow Ctr	✓ Wht Edge
Overall condition:	9-10 Very Good Condition - Little or no maint	enance required	Į	
Notes:				

LONDON GROVE TOWNSHIP DEPARTMENT OF PUBLIC WORKS

State Rd		Date:	1/24/2023
From: Rosehill Rd	To: Avondale	Borough	
Segment Length: 7302' Average Segment	: Width: 20'	☑ Dbl Yellow Ctr	✓ Wht Edge
Overall condition: 7-8 Good Condition - Routine maint	tenance, crack Sealing a	and Minor Patching Nee	eded
Notes:			
			4/04/2022
Strand Rd		Date:	1/24/2023
From: Whitestone Rd	To: Cul-De-Sa	c ·	•
Segment Length: 308' Average Segment	Width: 20'	☐ Dbl Yellow Ctr	└ Wht Edge
Overall condition: 7-8 Good Condition - Routine maint	tenance, crack Sealing	and Minor Patching Nee	eded
Notes:			**************************************
Stratford Dr		Date:	1/24/2023
From: Wickerton Rd	To: cul-de-sac	3	
Segment Length: 919' Average Segment	t Width: 24'	☐ Dbl Yellow Ctr	\square Wht Edge
Overall condition: 5-6 Fair Condition - Crack Sealing, A		eservative treatments re	ecommended
Notes:			
Notes,			<u>, , , , , , , , , , , , , , , , , , , </u>
Strode Rd		Date:	1/24/2023
From: Coastville Rd	To: E. Londor	Grove Rd	
Segment Length: 515' Average Segment	t Width: 13'	\square Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 5-6 Fair Condition - Crack Sealing, N	Major Patching, and Pre	eservative treatments re	ecommended
Notes:			
		Date:	1/24/2023
Sullivan Chase Dr	To: Garden S		_,
From: Sullivan Chase Dr		Dbl Yellow Ctr	☐ Wht Edge
Segment Length: 4525' Average Segmen			→ VALIE CARC
Overall condition: 9-10 Very Good Condition - Little o	r no maintenance requ	iired	
Notes:			

LONDON GROVE TOWNSHIP DEPARTMENT OF PUBLIC WORKS

Sullivan Rd		Date:	1/24/2023
From: Garden Station	Rd To: Cl	ay Creek Rd	
Segment Length: 384	Average Segment Width: 20'	✓ Dbl Yellow Ctr	\square Wht Edge
Overall condition: 9-10	Very Good Condition - Little or no maintenan	ice required	
Notes:			
			4 /0 4 /0 000
Sunrise Court		Date:	1/24/2023
From: Heather Grove	In To: Cu	ul-de-sac	g
Segment Length: 341	Average Segment Width: 23'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 5-6	air Condition - Crack Sealing, Major Patching,	and Preservative treatments re	commended
Notes:			
Tice Rd		Date:	1/24/2023
From: N. Guernsey Ro	To: De	ead End	
Segment Length: 1656	' Average Segment Width: 14'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 3-4	oor Condition - Structural Improvements, Lev	eling, and Overlay, or Recycling	recommended
Notes:			
Truman Lane		Date:	1/24/2023
From: Sullivan Chase	Or To: Ro	oosevelt Way	
Segment Length: 109	Average Segment Width: 20	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10	Very Good Condition - Little or no maintenan	nce required	
Notes:			
	, The state of the	Data	1/24/2022
Tulsk Rd		Date:	1/24/2023
From: Athelone Way		ul-de-sac	
Segment Length: 519	Average Segment Width: 24'	☐ Dbi Yellow Ctr	☐ Wht Edge
Overall condition: 9-10	Very Good Condition - Little or no maintenan	nce required	
Notes: Rolled curb, so	me standing curb		

DEPARTMENT OF PUBLIC WORKS

Valley Rd		Date:	1/24/2023
From: S. Guernsey Rd	To: Penn Town	ship	
Segment Length: 3945'	Average Segment Width: 20'	✓ Dbl Yellow Ctr	☐ Wht Edge
Overall condition: 9-10 Very God	od Condition - Little or no maintenance require	ed	
Notes:			
and the second s		_	4 /24 /2022
Vincent Place		Date:	1/24/2023
From: Auburn Rd	To: Jack Reynol		
Segment Length: 310'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	□ Wht Edge
Overall condition: 9-10 Very God	od Condition - Little or no maintenance requir	ed	
Notes: Standing curb			
Walter Rd		Date:	1/24/2023
From: Hilton Rd	To: Gap Newpo	ort Pike	
Segment Length: 4668'	Average Segment Width: 16'	☐ Dbl Yellow Ctr	☐ Wht Edge
0	idition - Routine maintenance, crack Sealing a	nd Minor Patching Nee	eded
Notes:	, and the state of		
Notes.			
Welcome Ave		Date:	1/24/2023
From: Chartwell	To: heather Gr	ove In	
Segment Length: 1753'	Average Segment Width: 23'	☐ Dbl Yellow Ctr	\square Wht Edge
_	ition - Crack Sealing, Major Patching, and Pres	ervative treatments re	ecommended
Notes:			
Welcome Ave		Date:	1/24/2023
From: Heathergrove Ln	To: West Grov	e Boro	
Segment Length: 1105'	Average Segment Width: 23'	☐ Dbl Yellow Ctr	\square Wht Edge
	lition - Crack Sealing, Major Patching, and Pres	ervative treatments r	ecommended
Notes:			
1101031			

DEPARTMENT OF PUBLIC WORKS

Welcome Ave			Date:	1/24/2023
From: Rosehill F	₹d	To: Chartwell		
Segment Length:	322'	Average Segment Width: 33'	\square Dbl Yellow Ctr	\square Wht Edge
Overall condition:	5-6 Fair Condition	on - Crack Sealing, Major Patching, and Prese	rvative treatments re	commended
Notes:				_
Wellsville Lane			Date:	1/24/2023
From: Rushford	Place	To: Letchworth	Lane	
Segment Length:	572'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge
Overall condition:	9-10 Very Good	Condition - Little or no maintenance require	ed	
Notes:				
West Avondale Rd			Date:	1/24/2023
From: S. Guerns	sey Rd	To: Hipkins Rd		
Segment Length:	2572¹	Average Segment Width: 20'	✓ Dbl Yellow Ctr	✓ Wht Edge
Overall condition:	9-10 Very Good	Condition - Little or no maintenance require	ed	
Notes:				
West Hunter Creel	〈 Dr		Date:	1/24/2023
From: Chatham	Chase Dr	To: Cul-de-sac		
Segment Length:	896'	Average Segment Width: 22'	\square Dbi Yellow Ctr	\square Wht Edge
Overall condition:	9-10 Very Good	Condition - Little or no maintenance require	ed	
Notes:				
West london Grove	o Dd		Date:	1/24/2023
From: N. Guern:		To: Chatham rd		1,24,2023
	4779 ¹	Average Segment Width: 18'	☑ Dbl Yellow Ctr	☐ Wht Edge
Segment Length: Overall condition:		-		~ wiit rake
	2-TO ASIÀ 0000	Condition - Little or no maintenance require	cu .	
Notes:				

DEPARTMENT OF PUBLIC WORKS

West Woodview Rd		Date:	1/24/2023	
From: Ewing Rd	To: Penn Township			
Segment Length: 1074'	Average Segment Width: 20'	Dbl Yellow Ctr	✓ Wht Edge	
Overall condition: 9-10 Very Good	Condition - Little or no maintenance require	d		
Notes:				
To Adam To Ada		A AMAZANIA (ABA		
Westview Dr		Date:	1/24/2023	
From: Martin Dr	To: Martin Dr			
Segment Length: 1577'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge	
Overall condition: 7-8 Good Condit	ion - Routine maintenance, crack Sealing and	l Minor Patching Nee	ded	
Notes: Rolled Curb				
Whitestone Dr		Date:	1/24/2023	
From: Martin Dr	r To: Garden Station Rd			
Segment Length: 1630'	Average Segment Width: 201	Dbl Yellow Ctr	☐ Wht Edge	
Overall condition: 7-8 Good Condit	ion - Routine maintenance, crack Sealing and	l Minor Patching Nee	ded	
Notes: Rolled Curb				
NA AND AND AND AND AND AND AND AND AND A				
Wiscoy Place		Date:	1/24/2023	
From: Friendship Dr	To: Cul-de-sac			
Segment Length: 544'	Average Segment Width: 20'	☐ Dbl Yellow Ctr	☐ Wht Edge	
Overall condition: 9-10 Very Good	Condition - Little or no maintenance required	t		
Notes:				
1000				
Moodulay Dd		Data	1/24/2023	
Woodview Rd	Tar Charles and Dal	Date:	1/24/2023	
From: Gap Newport Pike	To: Chatham Rd			
From: Gap Newport Pike Segment Length: 4981'	Average Segment Width: 191	☑ Db} Yellow Ctr		
From: Gap Newport Pike Segment Length: 4981'		☑ Db} Yellow Ctr		

DEPARTMENT OF PUBLIC WORKS

Woodview Rd		Date:	1/24/2023	
From: McCue R	d To: Gap New	To: Gap Newport Pike		
Segment Length:	6687' Average Segment Width: 19'	✓ Dbl Yellow Ctr	☐ Wht Edge	
Overall condition:	9-10 Very Good Condition - Little or no maintenance requ	iired		
Notes: White ed	ge line 1st 240' from RT41 - Bridge 24 ton restriction			
Woodview Rd		Date:	1/24/2023	
From: N. Guern	sey Rd To: Chatham		-, ,	
Segment Length:	5192' Average Segment Width: 18'	✓ Dbl Yellow Ctr	☐ Wht Edge	
Overall condition:	7-8 Good Condition - Routine maintenance, crack Sealing	and Minor Patching Nee	ded	
Notes:				
Marthia atau Du				
Worthington Dr		Date:	1/24/2023	
From: State Rd	To: Cul-de-Sa		_	
Segment Length:	2258' Average Segment Width: 24'	Dbl Yellow Ctr	☐ Wht Edge	
Overall condition:	5-6 Fair Condition - Crack Sealing, Major Patching, and Pre	eservative treatments re	commended	
Notes:				
Wreath Rd		Date:	1/24/2023	
From: Radance	Lane To: cul-de-sac		-,,	
Segment Length:		□ Dbl Yellow Ctr	☐ Wht Edge	
	702' Average Segment Width: 20'	- Doi Tellow Cti	□ wiit cuge	
Overall condition:			-	
Overall condition: Notes:	7-8 Good Condition - Routine maintenance, crack Sealing		_	